Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



© 2007 Mazda Motor of America, Inc.

Subject:

IGNITION COIL INSPECTION

Last Issued: 4/30/2007

APPLICABLE MODEL(S)/VINS

2004-2007 RX-8


DESCRIPTION

The following procedure is a supplement to the Workshop Manual procedure for ignition coil diagnostic testing.

INSPECTION PROCEDURE

NOTE:

- Before inspecting ignition coils, make sure the spark plug wires and spark plugs are in good condition. Defective spark plug wires and/or spark plugs may cause misdiagnosis and unnecessary replacement of ignition coils. Refer to B SPARK TEST.
- DO NOT diagnose ignition coil condition based on "white spots" or "heat marks" which may be found on the bottom of the ignition coil body.

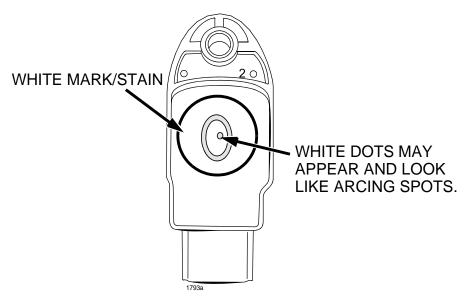

THESE ITEMS DO NOT INDICATE A BAD COIL. TESTING OF THE COIL MUST BE PERFORMED.

- 1. Warm engine to normal operating temperature.
- 2. Verify customer concern.

Page 1 of 4


CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ----without permission in writing.

Bulletin No: 01-016/07	Last Issued: 4/30/2007
© 2007 Mazda Motor of America, Inc.	

A - INSPECTION USING AN INDUCTIVE TIMING LIGHT

NOTE:

- Trailing ignition DOES NOT operate during engine cranking condition after Recall 4206F PCM calibration has been installed. Do not check coils during engine cranking condition.
- 1. Attach timing light to vehicle as per timing light manufactures instructions. (Positive & negative power leads to vehicle battery etc...)
- 2. With engine idling, carefully attach inductive lead of timing light to each spark plug wire.

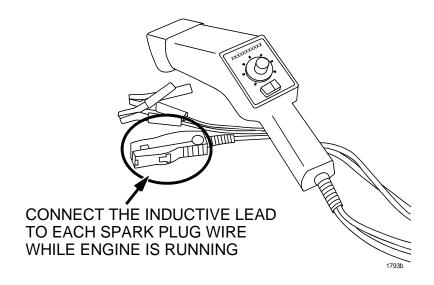

- 3. Verify timing light flashes when the inductive lead of timing light is attached to each spark plug wire.
- 4. Replace any ignition coil if the timing light does not flash with engine idling and / or unstable flash while revving engine.

B-SPARK TEST

1. Release fuel line pressure. Refer to Workshop Manual section 01-14 - FUEL LINE SAFETY PROCEDURE under BEFORE REPAIR PROCEDURE.

NOTE:

- Leave fuel pump relay removed from vehicle for the duration of the spark test procedure.
- 2. Verify that each high-tension lead (spark plug wire) and connector is connected properly.
- 3. Inspect the ignition system using the following procedure.

WARNING:

 High voltage in the ignition system can cause strong electrical shock which can result in serious injury. Avoid direct contact to the vehicle body during the following spark test.

Bulletin No: 01-016/07	Last Issued: 4/30/2007	l
© 2007 Mazda Motor of America, Inc.		l

STEP	INSPECTION	RESULTS	ACTION
1	Disconnect the high-tension lead from the spark plugs.		Ignition system is normal.
	Remove the spark plugs. Reconnect the spark plugs to the high-	NO	Some spark plugs do not spark: Go to the next step.
	tension lead. Ground the spark plugs to the engine. Is a strong blue spark visible at each spark plug while cranking?		All spark plugs do not spark: Go to Step 5.
2	Inspect the spark plugs for damage, wear,	YES	Go to the next step.
	carbon deposits and proper plug gap. Are the spark plugs normal?	NO	Replace the spark plugs, then go to Step 1.
3	Inspect the high-tension leads for	YES	Go to the next step.
	insulation damage, looseness, shorting or other damage. Are the high-tension leads normal?	NO	Replace the high-tension leads, then go to Step 1.
4	Inspect the following wiring harnesses for an open or short circuit: • Front trailing ignition coil terminal A - PCM terminal 2AD	YES	Inspect and replace the ignition coil. See C - IGNITION COIL INSPECTION.
	 Front leading ignition coil terminal A - PCM terminal 2AA Rear trailing ignition coil terminal A - PCM terminal 2AC Rear leading ignition coil terminal A - PCM terminal 2Z Are the wiring harnesses normal? 	NO	Repair or replace the malfunctioning parts, then go to Step 1.
5	Measure the voltage at terminal C in	YES	Go to the next step.
	ignition coil. Is the voltage reading B+?	NO	Inspect the power supply circuit of ignition coil.
6	Does the PCM connector or the ignition coil connector have poor connection?	YES	Repair or replace the connector, then go to Step 1.
		NO	Go to the next step.
7	Are the following items normal? • Eccentric shaft position sensor and drive belt pulley • PCM terminal 2Z/2AA/2AC/2AD	YES	Inspect for an open or short circuit in the wiring harness and the connector of the eccentric shaft position sensor.
	voltageSpecification: Approx. 1.5 V	NO	Repair or replace the malfunctioning parts, then go to Step 1.

4. Install the fuel pump relay.

Bulletin No: 01-016/07	Last Issued: 4/30/2007
© 2007 Mazda Motor of America, Inc.	

C - IGNITION COIL INSPECTION

Ignition Coil With Built-in Power Switch Inspection

- 1. Disconnect the ignition coil connector.
- 2. Measure the resistance between each terminal on the ignition coil connector.
- 3. If the measurement corresponds to the table, replace the ignition coil.

ITEM	TESTER CONNECTION POSITION		CONDITION	
ITEM	Positive	Negative	CONDITION	
-	A	В	Infinity or 0 ohm is not normal	
Terminal	В	С	- Initially of a drift is not normal	
	С	А	0 to several kilohm (continuity) is not normal	
C B A				