

Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun
Hiroshima 730-8670, Japan
TEL : 81(82)287-5323
FAX : 81(82)287-5220




Category S	Repair Guidance	Ref. No. R018/13	Page 1 of 4
Coverage <input type="checkbox"/> Distributor only <input checked="" type="checkbox"/> Please inform your dealers		Date Issued March 5, 2013	
Please convey this information to your <input type="checkbox"/> Director <input checked="" type="checkbox"/> General Manager <input checked="" type="checkbox"/> Warranty Dept. <input checked="" type="checkbox"/> Parts Dept. <input checked="" type="checkbox"/> Training Dept. <input checked="" type="checkbox"/> Field Rep.		Date Revised	
Applicable Model Mazda6 (GJ) Sedan	Applicable Countries or Specifications Worldwide		

Subject: Clicking Noise when opening Trunk Lid

DESCRIPTION

Some vehicles may exhibit a clicking noise at the moment the trunk lid is opened to the fully open position or just before the fully open position.

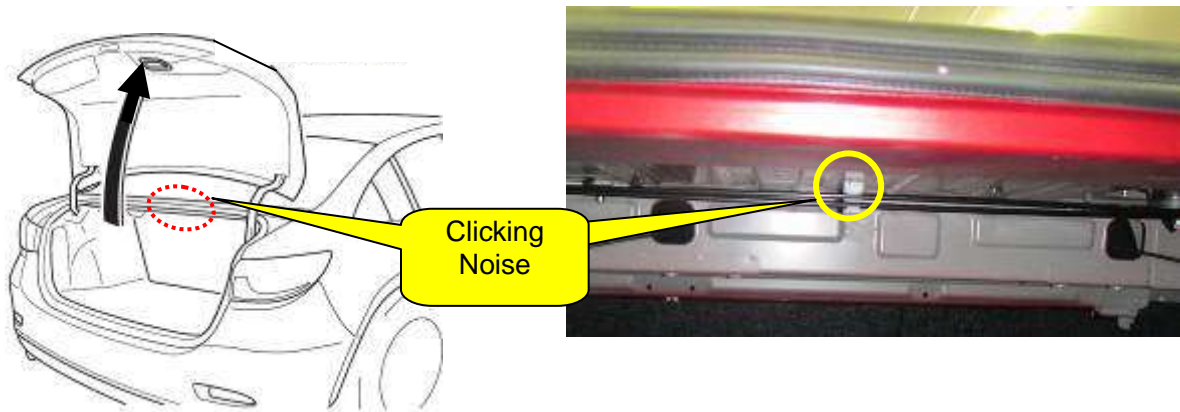

CAUSE

The balance springs are twisted when trunk lid is opened. This twisting motion causes the clip fixing the balance springs to move and scrape against the rear package tray panel, resulting in noise.

RODUCTION CHANGE

The clip configuration has been changed.

BEGINNING VIN & DATE OF MODIFICATION

EU Spec.

JMZ GJ***** 127873 February1, 2013

US Spec.

JM1 GJ***** 109003 February1, 2013

Israel Spec.

JMZ GJ***** 106179 February1, 2013

ADR Spec.

JM0 GJ***** 106179 February1, 2013

General Spec.


JM6 GJ***** 106179 February1, 2013

JM7 GJ***** 106179 February1, 2013


REPAIR PROCEDURE

Attach non-woven fabric sheets between the clip and the rear package tray panel to prevent the noise.


1. Select a sheet of non-woven fabric (0.25mm thickness) from the "Noise Parts Set" (TA01-76-100) and cut two pieces to a size of 7mm x 20mm.

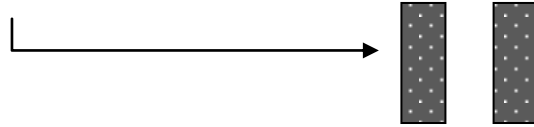

2. Open the trunk lid.
3. Pull down the clip by hand in the direction of the arrow in figure.
NOTE: Make a space between the clip and the rear package tray panel.

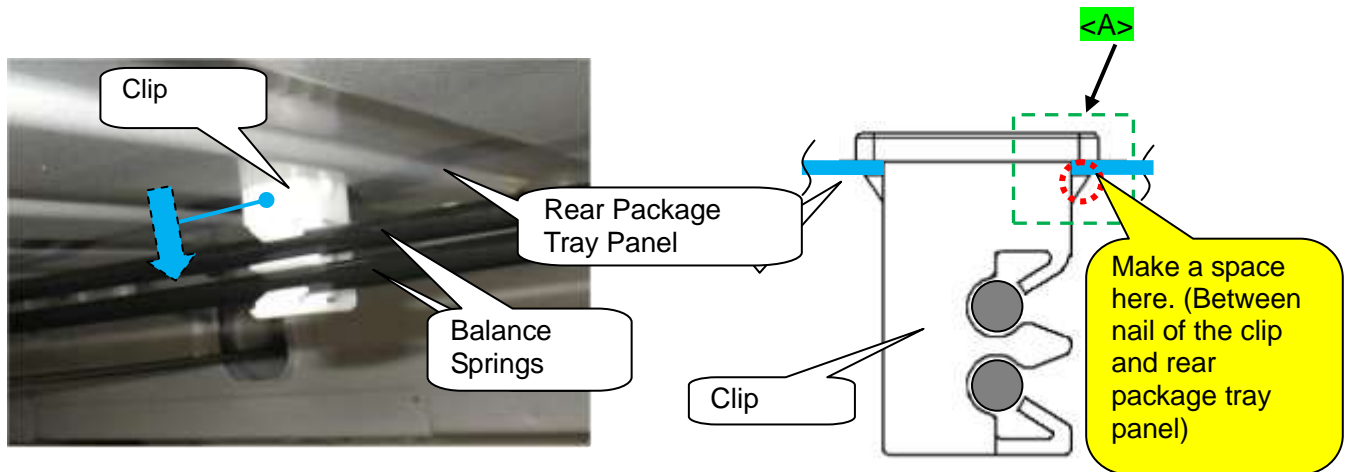


4. Insert the two sheets of non-woven fabric in layer (total 0.5mm thickness) in the space between the clip and the rear package tray panel.
NOTE: If it is difficult to insert the sheets by hand, use a flat-blade screwdriver to push it in.

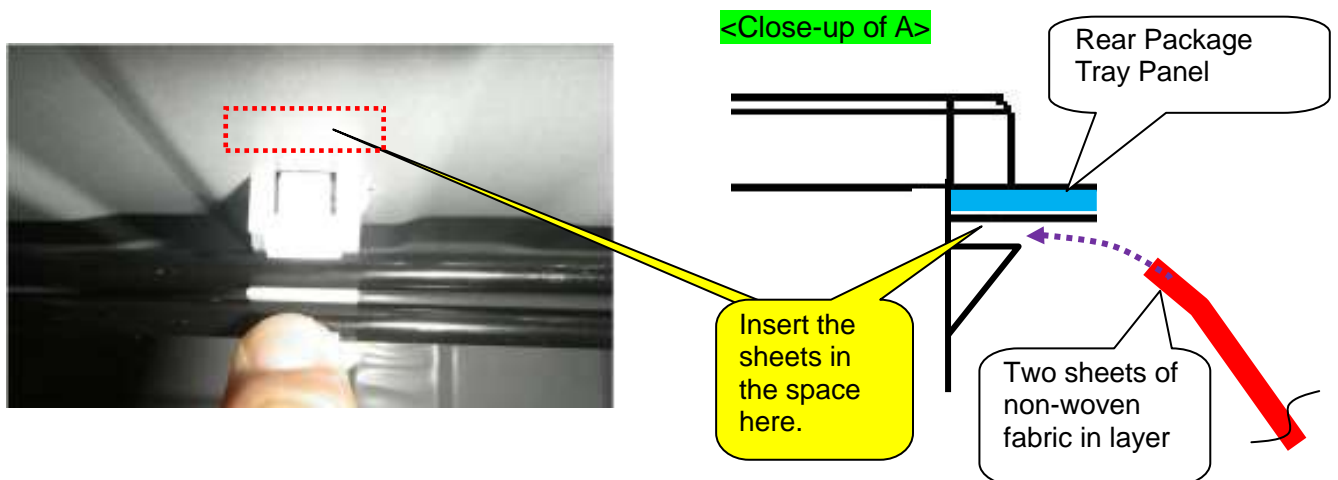


5. Attach the two sheets of non-woven fabric on the clip as shown in figure.

NOTE: The edge of the sheets should be attached on the clip so that it covers the contact area against the rear package tray panel.

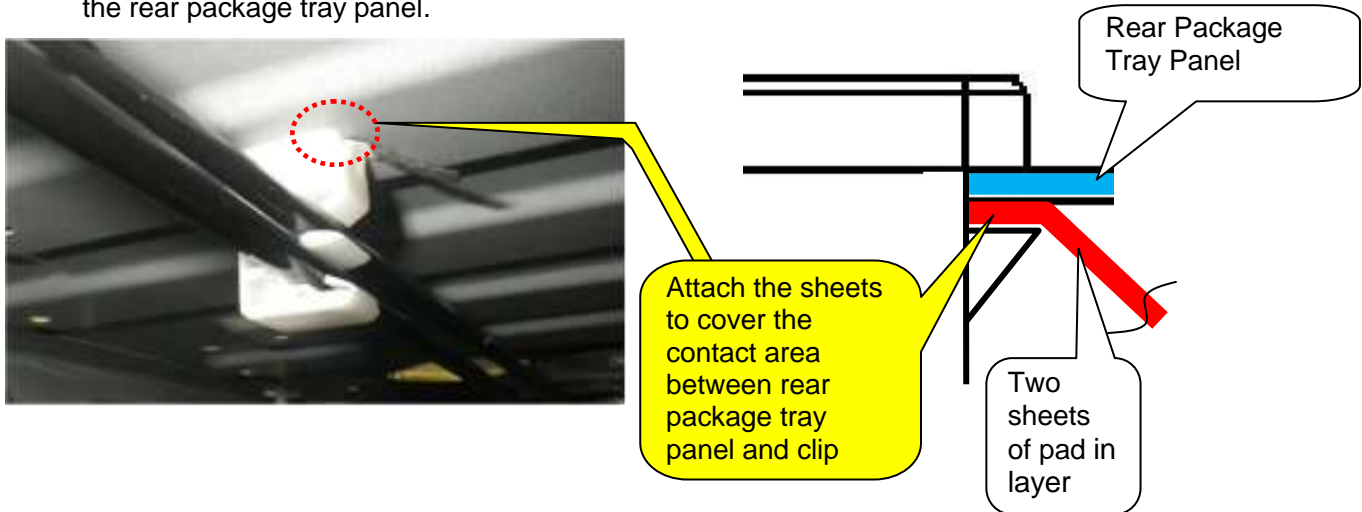

NOTE: Attach the sheets along with the configuration of clip.

NOTE: If the sheets reach the springs, cut the edge appropriately.

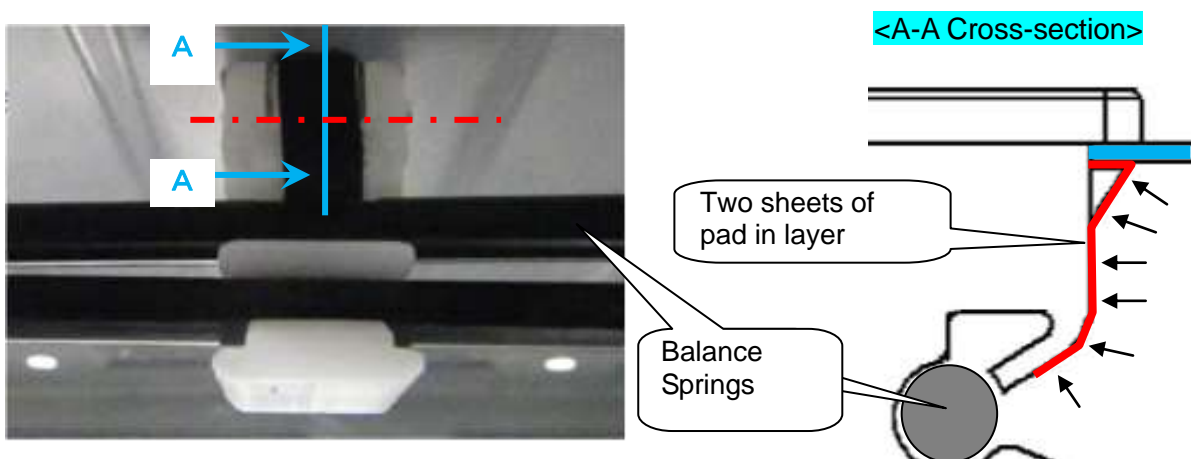

PARTS INFORMATION

Part Number	Part Name	Q'ty	Remark
TA01-76-100	Noise Repair Kit	1	Use 0.25mm thickness non-woven fabric Can be used for 53 vehicles.

WARRANTY INFORMATION

Assembly group	S – Body
Subassembly group	12 – LIFT GATE
Symptom Code	82
Damage Code	97
Causal Part No.	GHK1-56-894 (Clip)
Q'ty	0
Operation No. & Labor Hours	XXJ4AXRX & 0.2H
Period Covered	Normal warranty period

Note: For noise part set, claim as related part at first time repair.

Mitsunori Tokunaga
Manager, Technical Information Gr.
Technical Service Dept.
Mazda Motor Corporation
1CC0731451 (MC Internal Use)