


Category F	M-tips	Ref. No. MME/GJ01/13	Page 1 of 2
Model: Mazda6 (GJ)		Date Issued April 30, 2013	Date Revised
Subject: DTC U0121 (ABS/DSC control module communication failure) stored during PCM reprogramming		Applicable Countries or Specification Europe	

PROBLEM DESCRIPTION

During PCM reprogramming, some vehicles may show some warning messages with flashing Start stop switch. This is caused by reset function of ABS/DSC CU not working properly.

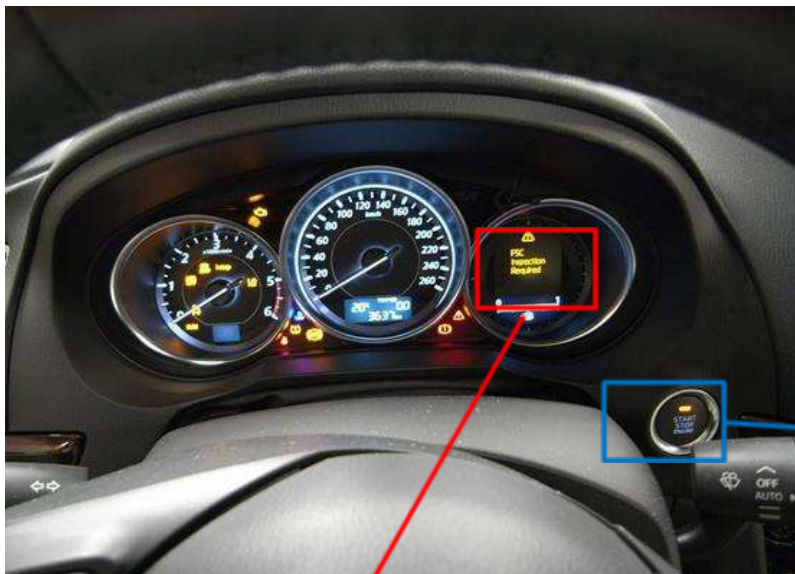

Start Stop switch light flashes.




Below warning messages are displayed.



REPAIR PROCEDURE

1. Turn the IG-off by pushing Start Stop switch for long time (around 3 seconds) to turn off.
2. After that, disconnect **ABS/DSC S 30A** Fuse for 30 seconds so that the system is reset back to normal.

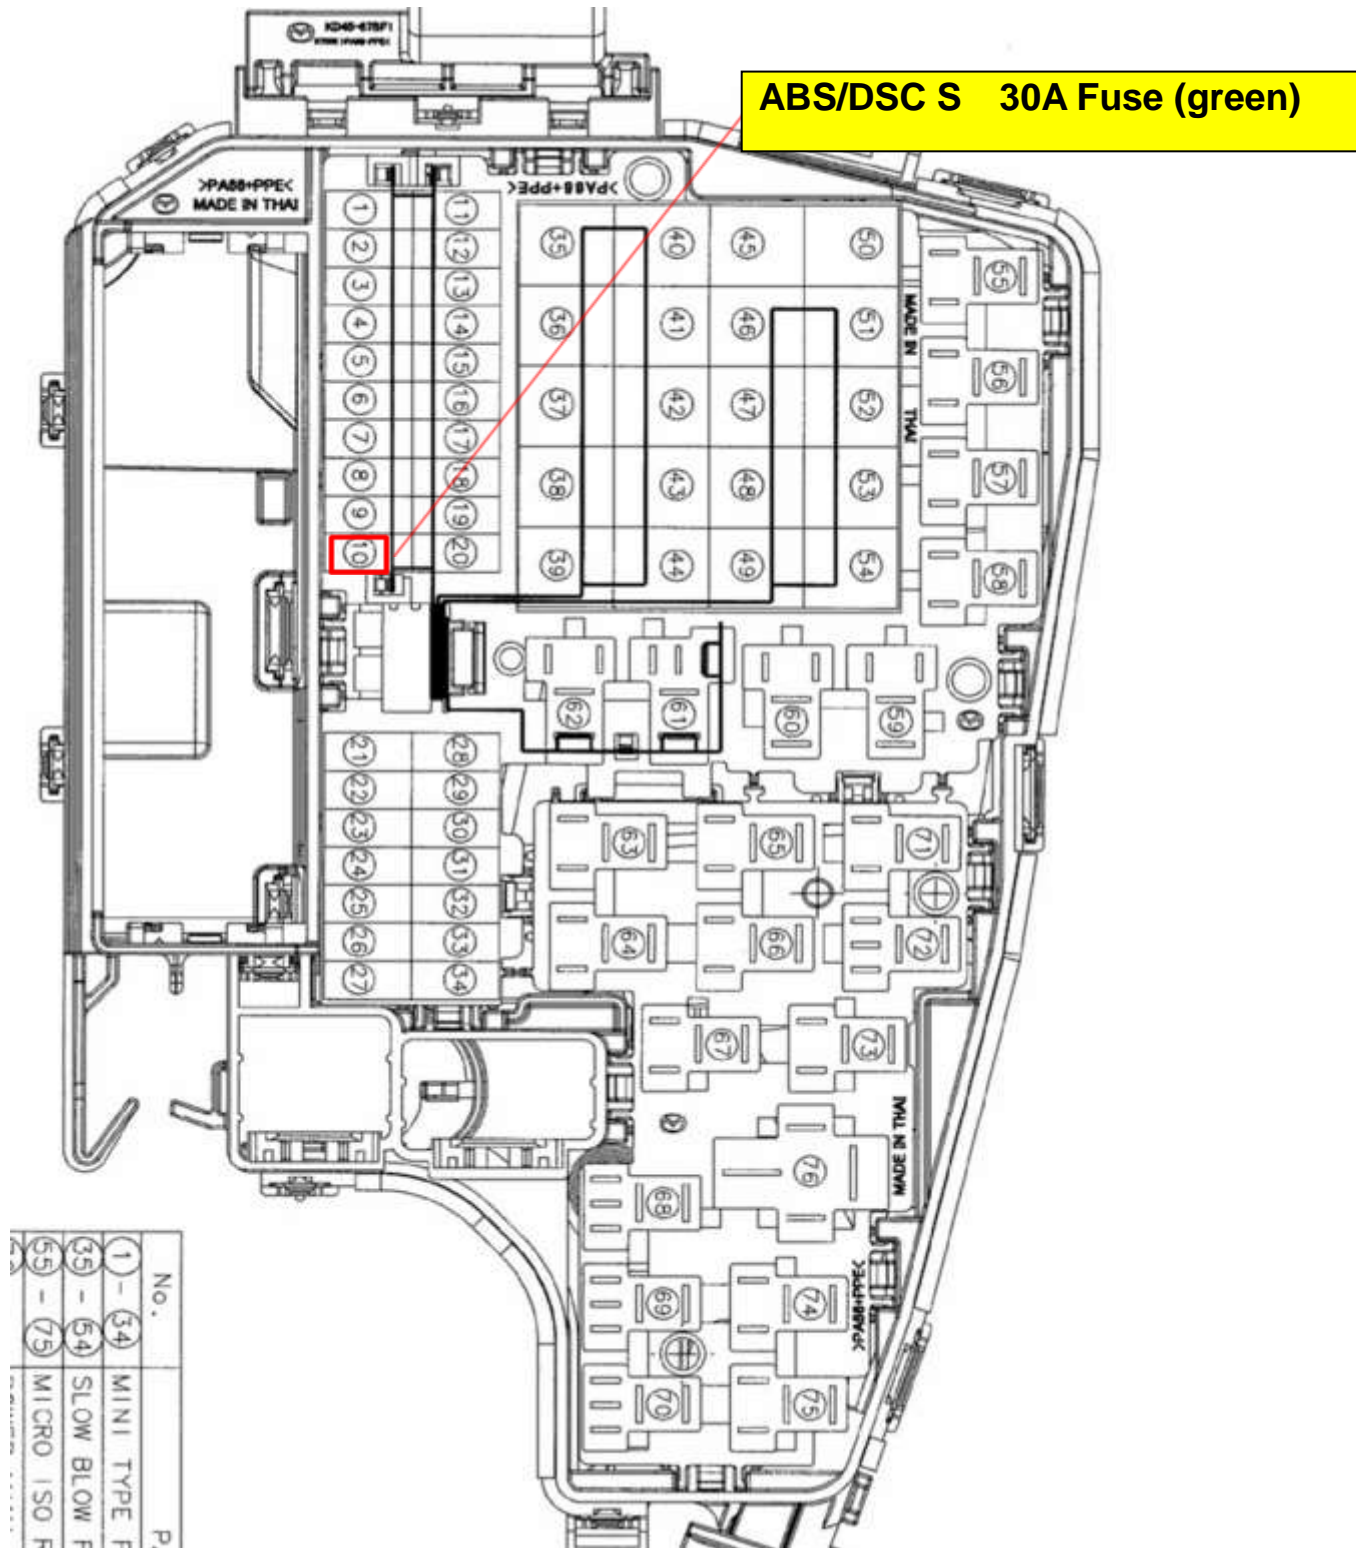

Note: There is similar name fuse "ABS/DSC M 50A, that's wrong one.

End of document.