Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun Hiroshima 730-8670, Japan TEL: 81(82)287-5323 FAX: 81(82)287-5220



Category T	Repair Guidance		Ref. No. R034/13	Page 1 of 2
Coverage ☐ Distributor only ■ Please inform your dealers			Date Issued May 13, 2013	
Please convey this information t ■ Warranty Dept. ■ Parts De	<i>'</i> – –	ıl Manager Rep.	Date Revised	
Applicable Model		Applicable Countries or Specifications		
Mazda6 (GJ) with Mazda Radar Cruise Control (MRCC)		Worldwide		


Subject: MRCC warning turns on with DTC C1A67:92

DESCRIPTION

Some vehicles may experience the MRCC warning turns on with the following message and DTC C1A67:92 stored in memory.

C1A67:92 - Radar sensor sensitivity lowered

[MRCC warning on liquid crystal display]

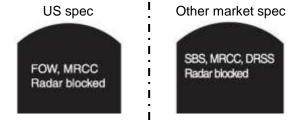

CAUSE

Some radar sensors produced in a specified period are defective and they incorrectly detect as if dirt is adhered on the radar.

MASS PRODUCTION CHANGE


Inspection process at the production of radar sensor has been improved.

SUBJECT VIN RANGE & PRODUCTION PERIOD

Erom			То	
Spec	From		То	
Opec	VIN	Date	VIN	Date
ADR	JM0GJ***** 101551		JM0GJ***** 107986	
Algeria	GJ***** 101551	7	GJ***** 107986	
Conoral	JM6GJ***** 101551	Dogombor 2	JM6GJ***** 107986	Fobruary 21
General -	JM7GJ***** 101551	December 3, 2012	JM7GJ***** 107986	February 21, 2013
Israel	JMZGJ***** 101551	2012	JMZGJ***** 107986	2013
EU	JMZGJ***** 115136		JMZGJ***** 129778	1
US	JM1GJ***** 103113		JM1GJ***** 112154	İ

REPAIR PROCEDURE

When you encounter a customer complaint on this concern, perform diagnosis according to Workshop Manual "DTC C1A67:92 [VEHICLE CONTROL MODULE(V/C MODULE)]". If diagnosis does not show any other reason, replace the radar sensor with a new one according to the Workshop Manual "RADAR SENSOR REMOVAL/INSTALLATION [MAZDA RADAR CRUISE CONTROL (MRCC) SYSTEM]".

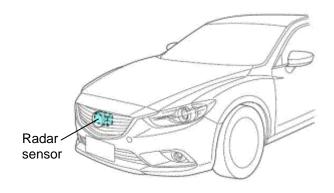

PART INFORMATION

Part Number	Part Name	Q'ty
GHP9 67 XA1A	Radar sensor	1

WARRANTY INFORMATION

Assembly group	T – Body Electrical
Subassembly group	08 - AUTO CRUISE CONTROL SYSTEM
Symptom Code	61
Damage Code	9W
Causal Part No.	GHP9 67 XA1 A
Q'ty	1
Operation No. &	XXJ6PXRX & 0.7Hrs (without i-stop)
Labor Hours	XXJ6RXRX & 0.8Hrs (with i-stop)
Period Covered Normal warranty period	

Ryu Shimizugawa Manager, Technical Information Gr. Technical Service Dept. Mazda Motor Corporation

1D20413212 (MC Internal Use)