Service Bulletin Mazda North American Operations

Irvine, CA 92618-2922



© 2013 Mazda Motor of America, Inc.

Subject: Bulletin No: 00-002/13 **NEW MODEL SERVICE CAUTIONS** Last Issued: 06/28/2013

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 00-003/12, issued on 12/11/2012. The DESCRIPTION and SERVICE CAUTIONS have been revised.
- Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S)/VINS

2014 Mazda6

DESCRIPTION

This Service Information is being issued to advise dealers about the following service cautions for the 2014 Mazda6. Ensure that all appropriate dealer personnel have been advised of this service information:

- Automatic Transaxle Oil
- Q85 Battery

i-ELOOP

Engine Oil

- Tire Pressure Monitoring System (TPMS)
- **Navigation System**

- Manual Transaxle Oil
- Kickdown Switch (ATX)

Maintenance Monitor

- Spark Plug
- · Front Bumper Removal


SERVICE CAUTIONS

Automatic Transaxle Oil:

Only use "Automatic Transmission Fluid (ATF) FZ" for SKYACTIV-DRIVE. "ATF-FZ" is a low viscosity formula with less friction for better fuel economy. If an ATF other than "ATF-FZ" is used in the SKYACTIV-DRIVE ATX, the performance and reliability cannot be guaranteed. Any resulting damage will not be covered by warranty.

NOTE:

- ATF-FZ is colored blue, for easy identification. For ATX that requires ATF-FZ, "FZ" is marked on the dipstick as shown below.
- Flushing machines that "recondition" the existing ATF should never be used.
- A/T oil cooler flush is not required.

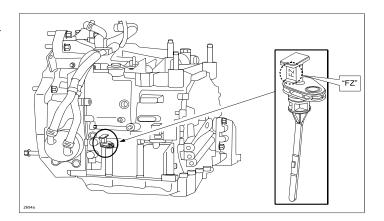

Page 1 of 6

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

Bulletin No: 00-002/13	Last Issued: 06/28/2013
© 2013 Mazda Motor of America, Inc.	

Engine Oil:

Only use the following engine oil for the SKYACTIV-G 2.5 engine.

Engine Oil	For U.S.A. and Canada	SAE 0W-20
Lingine Oil	Except U.S.A. and Canada	SAE 5W-30

Manual Transaxle Oil:

GL-4 (75W-80) for the existing MTX can also be used for the SKYACTIV-MT.

Spark Plug:

Always make sure to use the designated spark plugs for SKYACTIV-G 2.5 engine. Usage of general nickel or iridium plugs for SKYACTIV-G could result in engine knocking, MIL illumination and/ or poor drivability.

Q85 Battery (vehicles equipped with i-ELOOP):

This Battery is used for vehicles equipped with SKYACTIV-G and i-ELOOP. This battery is exclusively designed for high charge acceptance, longer life and high current, to ensure durability and reliability. Using another type of battery could result in lower performance and shorter battery life. Due to the difference of battery characteristics, the vehicle may falsely detect the non-Q85 battery as malfunctioning and stops/restricts the i-ELOOP function.


Refer to TSB 01-016/13- 2014 MAZDA6 - i-ELOOP BATTERY SERVICE INFORMATION.

Tire Pressure Monitoring System (TPMS):

The tire pressure monitoring system monitors the tire pressure based on the signal from the ABS wheel-speed sensors on each wheel. When any of the services below are performed, **BE SURE TO INITIALIZE THE TPMS BEFORE DRIVING THE VEHICLE** by pushing and holding the TPMS Set Switch on the dash (until the TPMS warning light flashes two times and the warning beep sounds once)


The TPMS must be initialized in the following cases:

- Tire pressures have been adjusted in one or more tires.
- · Tires have been rotated.
- Tires or wheels have been replaced.
- The vehicle's battery cable has been disconnected for any reason.
- The vehicle's battery has been discharged.
- The DSC HU/CM connector has been disconnected for any reason.

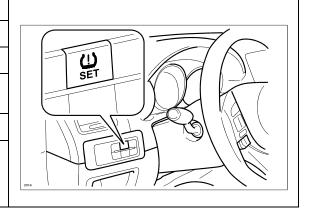


Bulletin No: 00-002/13	Last Issued: 06/28/2013
© 2013 Mazda Motor of America, Inc.	

Kickdown Switch (ATX):

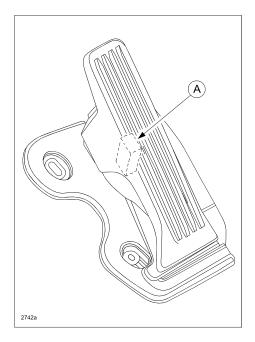

A kickdown switch (A) has been adopted to determine that the customer has fully depressed the throttle pedal for maximum acceleration. A load can be felt while the accelerator pedal is being depressed and when it is further depressed the kickdown switch is activated. A click is felt when the kickdown switch is activated.

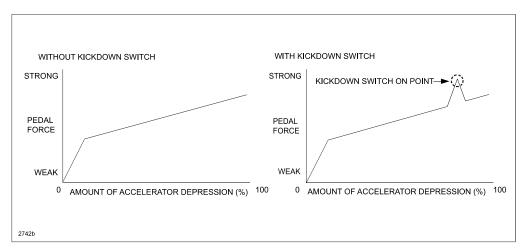

The driver can control the kickdown by knowing the amount of accelerator depression. The kickdown switch is only a measure of the kickdown. An electrical signal is **not transmitted** by the kickdown switch turning on/off, and vehicle control is not affected.

 Bulletin No:
 00-002/13

 © 2013 Mazda Motor of America, Inc.
 Last Issued:
 06/28/2013

Front Bumper Removal:

Pull the front bumper slider (A) in direction of arrow (2) as shown in the figure, while removing the edge of the front bumper (B) in the direction of the arrow (1) shown in the figure. C Pull the edge of the front bumper (B) in the direction of the arrow (3) as shown in the figure, and then remove tabs (H). (D). If you pull the edge of the front bumper (B) to outside of vehicle (E) before grommet (D) removal, the fastening part of front bumper could be broken (F). (E)

A - Front Bumper Slider

E - Outside Of Vehicle F - Could Be Broken

C - Front Bumper D - Grommet

H - Tab

B - Edge Of The Front Bumper


 Bulletin No:
 00-002/13

 © 2013 Mazda Motor of America, Inc.

Last Issued: 06/28/2013

i-ELOOP:

For improved fuel economy, electrical power is generated using kinetic energy during deceleration and retrieved as electrical energy, which decreases the amount of fuel used for supplying power. The Mazda-unique regenerative braking system stores large quantities of energy instantly during deceleration using a Capacitor (i-ELOOP) which can be tapped quickly for use. Through efficient regenerative braking, storage and use, effective fuel economy improvement while driving can be expected.

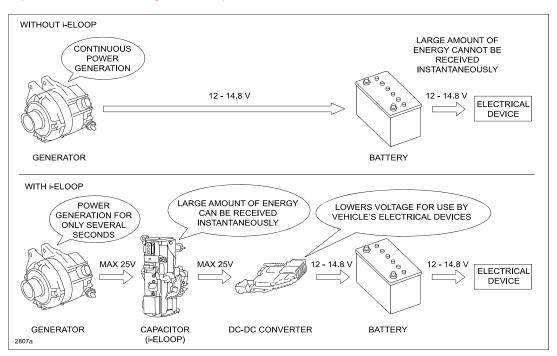

NOTE: The capacitor stocked as a repair part must be used within 2 years after production date. The production date is indicated on the outer case of the repair part. When the capacitor is stored, keep it upright. When you dispose of the vehicle or the capacitor, be sure to conduct the forced discharge of the capacitor before disposal according to MS3 on line or Workshop Manual (section 13-17 CAPACITOR (i-ELOOP) COMPULSORY DISCHARGE [i-ELOOP]).

Bulletin No: 00-002/13	Last Issued: 06/28/2013
© 2013 Mazda Motor of America, Inc.	

Navigation System:

The navigation has a function called "Latest Map Guarantee" (LMG), which provides complimentary map updates for a limited period of time.


When a starting condition for LMG (i.e. destination setup) is performed, the internal timer automatically starts the clock for the time period. Therefore, make sure NOT to operate the navigation when the vehicle is received. Only operate the navigation before handing over the vehicle to the customer to ensure the they get usage of the full time period of LMG.

NOTE: It is not possible to stop the clock for LMG once it has started.

Refer customer to www.mazdausa.com/navigation for more information.

Maintenance Monitor:

When the preset maintenance period approaches, the maintenance monitor displays a message on the LCD display (A) in the instrument cluster to inform the driver.

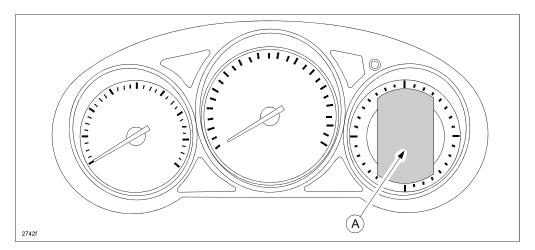

Maintenance settings for the scheduled maintenance, tire rotation, tire pressure and maintenance display/non-display can be set according to user option. Refer to the Workshop Manual for the setting procedure. The initial default setting is Off.