## **Service Information**

#### Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun Hiroshima 730-8670, Japan TEL: 81(82)287-5323 FAX: 81(82)287-5220




Category <b>S</b>	Repair Gui	Ref. No. R076/13	Page 1 of 5	
Coverage  ☐ Distributor only ■ Please inform your dealers			Date Issued October 2, 2013	
Please convey this information t  ■ Warranty Dept. ■ Parts De	ll Manager Rep.	Date Revised		
Applicable Model		Applicable Countries or Specifications		
Mazda6 (GJ)		Worldwide		

## Subject: Rear door weatherstrip out of position

### **DESCRIPTION**

Some vehicles may exhibit that the top edge of rear door weatherstrip is detached from fastener

which gives poor appearance.

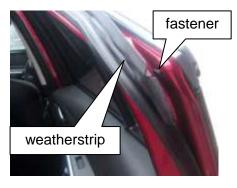

## **CAUSE**

The size of fastener does not match properly to the hole of weatherstrip.


## MASS PRODUCTION CHANGE


TBC

# BEGINNING VIN & DATE OF MODIFICATION TBD


#### REPAIR PROCEDURE

- \* Repair both rear doors together.
  - 1. Verify if the hole in weatherstrip for fastener is not cracked as shown in below pictures. If it is cracked such as picture "NG", replace weatherstrip with a new one.
    - \* When replacing the weatherstrip, verify there is no water leakage.

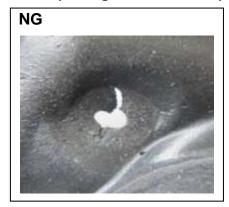


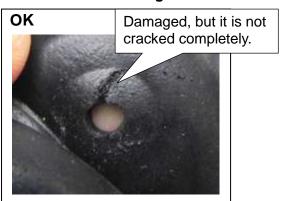

- 2. Remove the weatherstrip (if not detached already) and the fasteners from both rear doors.
  - \* Be careful not to damage the fastener hole in weatherstrip during removal..
- 3. Cut off the new fastener (GHY0-58-762) one notch from end as shown in following pictures.

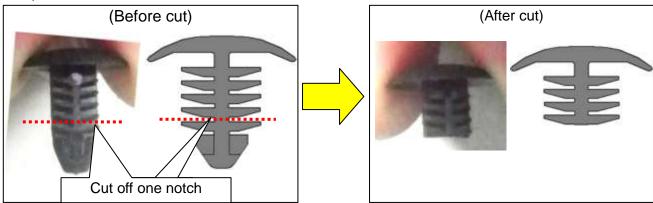

- 4. Install the cut fasteners to both rear doors' weatherstrip.
  - \* Do not install the weatherstrip to the door panel yet.

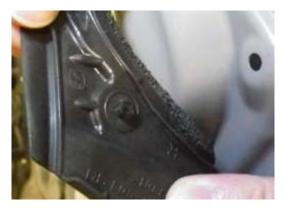



5. Clean the bonded area of weatherstrip and door panel. (Dotted line area of picture)



- 6. Apply the bond from the end of EPT sealer up to 10 mm below from R or L mark following EPT sealer.
  - \* Do not apply the bond more than 10 mm from R or L mark to prevent waste application.

Bond: Three Bond TB1521 or Wuerth 0890 100 015 "Profile Rubber Glue" or equivalent.

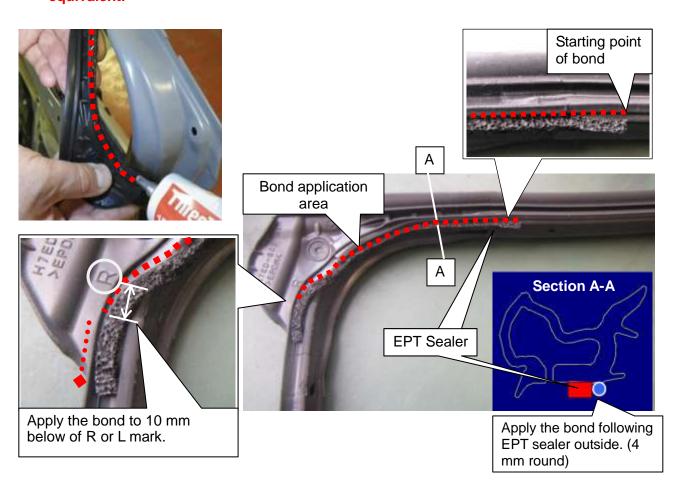


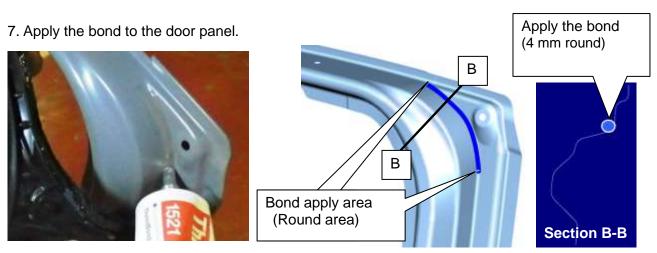


8. Dry the bond until it's surface does not stick to finger.



9. Install the weatherstrip to the door panel and press the bonding area of it.

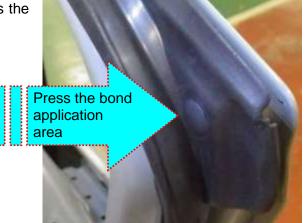

10. Verify there is no waste application of bond.

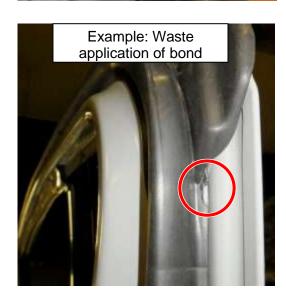

\* Rework the other door's weatherstrip in the same way.

## PART INFORMATION

Part Number		Dort Name	O't.	Domark		
New	Old	Part Name	Q'ty	Remark		
GHY0-58-762	_	fastener	2			
GHK1-72-760A	GHK1- 72-760	we ather strip (R)	1	4SD	Replacement parts if the fastener hole of weatherstrip is damaged (cracked)	
GHK1-73-760A	GHK1-73-760	weatherstrip (L)	1	430		
GHP9-72-760B	GHP9-72-760A	weatherstrip(R)	1	WGN		
GHP9-73-760B	GHP9-73-760A	weatherstrip(L)	1	WGN		

## **WARRANTY INFORMATION**

Assembly group	S - Body			
Subassembly group	11 - REAR DOORS			
Symptom Code	91			
Damage Code	97			
Causal Part No.	GHY0-58-762			
Q'ty	2			
Operation No.& Labor Hours	XXJAXXRX & 0.4H (Replace the fastener both sides)			
	XXJAYXRX & 0.6H (Replace the fastener both sides & weatherstrip one side.)			
	XXJAZXRX & 0.8H (Replace the fastener both sides & weatherstrip both sides.)			
Period Covered	Normal warranty period			

Ryu Shimizugawa Manager, Technical Information Gr. Technical Service Dept. Mazda Motor Corporation 1D40133818 (MC Internal Use)