

Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun
Hiroshima 730-8670, Japan
TEL : 81(82)287-5323
FAX : 81(82)287-5220



Category T	Repair Guidance	Ref. No. R110/13	Page 1 of 2
Coverage <input type="checkbox"/> Distributor only <input checked="" type="checkbox"/> Please inform your dealers		Date Issued December 24, 2013	
Please convey this information to your <input type="checkbox"/> Director <input checked="" type="checkbox"/> General Manager <input checked="" type="checkbox"/> Warranty Dept. <input checked="" type="checkbox"/> Parts Dept. <input checked="" type="checkbox"/> Training Dept. <input checked="" type="checkbox"/> Field Rep.		Date Revised	
Applicable Model Mazda3 (BM) with Center Display	Applicable Countries or Specifications Worldwide		

Subject: Commander Switch caves in

DESCRIPTION

Some vehicles may experience a condition where the commander switch caves in from the panel.

(Rear side caves in)




(Front side caves in)



CAUSE

An excessive vertical force may be applied to the commander switch which causes damage of the hook(s) fixing the commander switch to the frame.

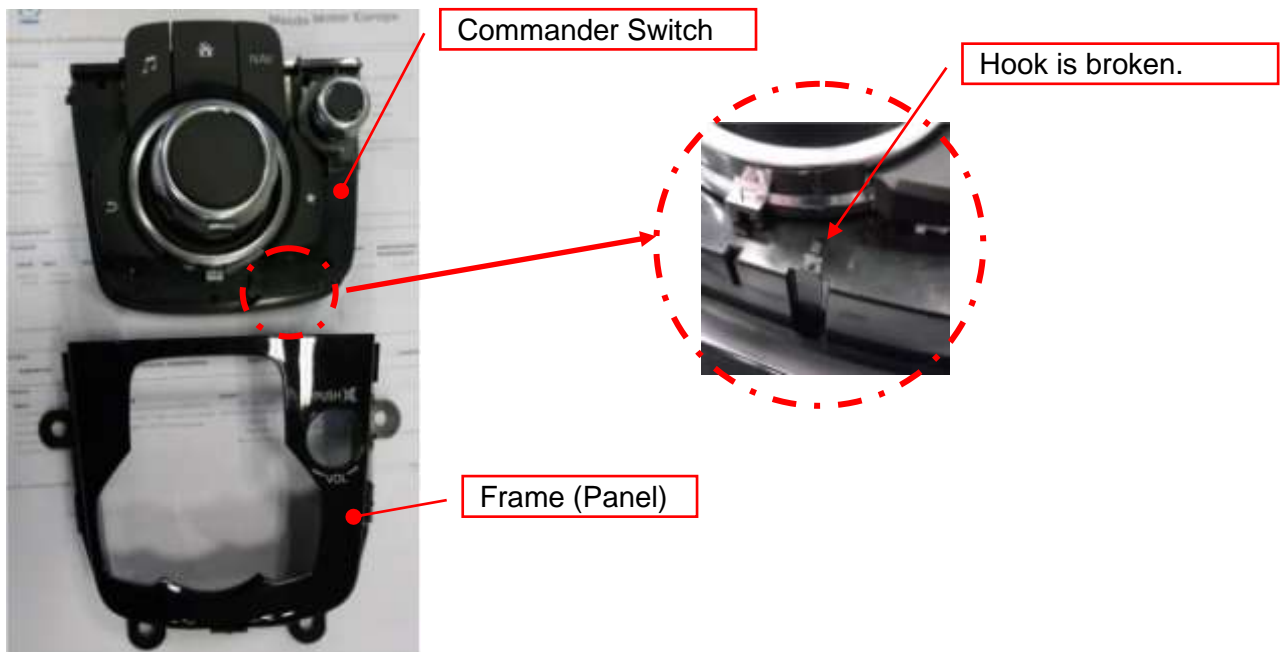

MASS-PRODUCTION CHANGE

Pieces of non-woven fabric have been added to the commander switch to increase the load capacity against a vertical force.

BEGINNING VIN & DATE OF MODIFICATION

EU spec.

JMZ BM **** ** 127065 November 6, 2013

ADR spec.

JM0 BM **** ** 100156 November 6, 2013

US spec.

JM1 BM **** ** 142131 November 6, 2013

General spec.

JM6 BM **** ** 100156 November 6, 2013

JM7 BM **** ** 100156X November 6, 2013

REPAIR PROCEDURE

Verify the customer concern.

Replace the commander switch with a modified one according to the instructions in the Workshop Manual "COMMANDER SWITCH REMOVAL/INSTALLATION".

PARTS INFORMATION

Part Number		Part Name	Q'ty	Remark
New	Old			
BHN1-66-CM0C	BHN1-66-CM0B	Commander Switch	1	For LHD vehicle
B45A-66-CM0C	B45A-66-CM0B	Commander Switch	1	For RHD vehicle

WARRANTY INFORMATION

Assembly group		T – Body electrical system
Subassembly group		02 - SWITCHES
Symptom Code		89
Damage Code		9A
DTC Code		-
Causal Part No.		BHN1-66-CM0C or B45A-66-CM0C
Q'ty		1
Operation No. & Labor Hours	Commander Switch, R&R (Without i-stop)	XXK22ARX, 0.2Hrs.
	Commander Switch, R&R (With i-stop)	XXK22BRX, 0.3Hrs.
Period Covered		Normal warranty period

Ryu Shimizugawa
Manager, Technical Information Gr.
Technical Service Dept.
Mazda Motor Corporation
2D91112222 (MC Internal Use)