

Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun
Hiroshima 730-8670, Japan
TEL : 81(82)287-5323
FAX : 81(82)287-5220



Category T	Technical	Ref. No. E018/13A	Page 1 of 1
Coverage <input type="checkbox"/> Distributor only <input checked="" type="checkbox"/> Please inform your dealers		Date Issued August 6, 2013	
Please convey this information to your <input type="checkbox"/> Director <input checked="" type="checkbox"/> General Manager <input checked="" type="checkbox"/> Warranty Dept. <input checked="" type="checkbox"/> Parts Dept. <input checked="" type="checkbox"/> Training Dept. <input checked="" type="checkbox"/> Field Rep.		Date Revised November 6, 2013	
Applicable Model Mazda6(GJ) with RVM System		Applicable Countries or Specifications Europe	

REVISED

Revision Note: This Service Information is to thoroughly revise the previous Service Information E018/13 dated August 6, 2013.

Subject: Configuration cannot be completed after replacement of Rear Vehicle Monitoring (RVM) Control Module

DESCRIPTION

Module configuration cannot be completed after one side RVM control module was replaced due to accident repair or other reason. In some cases, related DTCs are stored and can't be erased.

CAUSE

The software versions of the right and left RVM control modules after the repair may be unmatched. If the software version is different between the left and right RVM control modules, the RVM system will not work and the configuration cannot be completed.

This happens in case RVM unit's part suffix is B or older. The vehicle with RVM unit's suffix C and/or later will not be affected by this concern.

Note:

VIN produced after Sept. 21, 2013 (JMZGJ**** **149453):

In case the vehicle with RVM unit which has C or later suffix on both sides, only the damaged RVM unit needs to be replaced as RVM unit with C or later suffix can be configured.

VIN produced before Sept. 21, 2013 (JMZGJ**** **149453):

In case the vehicle with RVM unit which has B or older suffix, and one side got damaged, the same suffix of RVM unit like the damaged one must be used. (C or later suffix cannot work with B or older suffix.) If the unit with the same suffix like the damaged one is no longer available, both sides need to be replaced with C or later suffix

Original RVM unit installed	Note for repair	
With C or later suffix	Only damaged unit need to be replaced (use C or later suffix)	
With B or older suffix	If the same suffix is available as a spare part:	Unit with the same suffix on damaged unit is used. (One side replacement is sufficient))
	If only C or later suffix is available as a spare part:	Unit with C or later suffix should be installed for both sides. (Both side replacement is necessary)

Ryu Shimizugawa
Manager, Technical Information Gr.
Technical Service Dept.
Mazda Motor Corporation
1D20413212 (MC Internal Use)