

Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun
Hiroshima 730-8670, Japan
TEL : 81(82)287-5323
FAX : 81(82)287-5220



| | | | |
|--|------------------------|---|----------------|
| Category S | Repair Guidance | Ref. No. R010/14A | Page 1 of 2 |
| Coverage <input type="checkbox"/> Distributor only <input checked="" type="checkbox"/> Please inform your dealers | | Date Issued January 23, 2014 | |
| Please convey this information to your <input type="checkbox"/> Director <input checked="" type="checkbox"/> General Manager <input checked="" type="checkbox"/> Warranty Dept. <input checked="" type="checkbox"/> Parts Dept. <input checked="" type="checkbox"/> Training Dept. <input type="checkbox"/> Field Rep. | | Date Revised January 29, 2014 | |
| Applicable Model Mazda6 (GJ) | | Applicable Countries or Specifications Worldwide | |

REVISED

Revision Note: "BEGINNING VIN & DATE OF MODIFICATION" has been revised.

Subject: Bonnet vibrates when driving at more than 110 Km/h

DESCRIPTION

Some vehicles may exhibit a condition that the bonnet vibrates when driving at vehicle speeds of more than 110Km/h.

CAUSE

The preload forces of the cowl grill seal may be insufficient which can also affect the bonnet vibration adversely.

MASS PRODUCTION CHANGE

The preload force of the cowl grill seal has been increased to reduce bonnet vibration.

BEGINNING VIN & DATE OF MODIFICATION

US spec

JM1 GJ **** ** 162912 December 3, 2013

EU spec

JMZ GJ **** ** 159107 December 3, 2013

ADR spec

JM0 GJ **** ** 127690 December 3, 2013

General spec

JM6 GJ **** ** 127714 December 3, 2013
JM7 GJ **** ** 127688 December 3, 2013

Israel spec

JMZ GJ **** ** 127688 December 3, 2013


Algerian spec

GJ **** ** 127688 December 3, 2013

REPAIR PROCEDURE

Replace the cowl grill seal with a modified one with increased preload force.

Note: The cowl grill seal is attached to the cowl grill with clips.

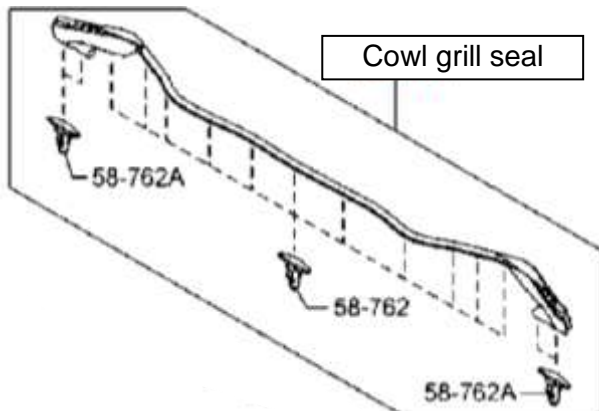

PARTS INFORMATION

| Part Number | | Part Name | Q'ty |
|--------------|-------------|-----------------|------|
| New | Old | | |
| GHP9-56-760A | GHP9-56-760 | Cowl Grill Seal | 1 |

WARRANTY INFORMATION

| | |
|------------------------------|--------------------------------|
| Assembly group | S - Body |
| Subassembly group | 05 - BONNET (HOOD) & TRUNK LID |
| Symptom Code | 83 |
| Damage Code | 97 |
| Causal Part No. | GHP9-56-760A |
| Q'ty | 1 |
| Operation No. Labor Hours | XXK38XRX & 0.2H |
| Period Covered | Normal warranty period |

Ryu Shimizugawa
Manager, Technical Information Gr.
Technical Service Dept.
Mazda Motor Corporation
2D32810514
(MC Internal Use)