

Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun
Hiroshima 730-8670, Japan
TEL : 81(82)287-5323
FAX : 81(82)287-5220



Category S	Repair Guidance	Ref. No. R009/14	Page 1 of 2
Coverage <input type="checkbox"/> Distributor only <input checked="" type="checkbox"/> Please inform your dealers		Date Issued January 23, 2014	
Please convey this information to your <input type="checkbox"/> Director <input checked="" type="checkbox"/> General Manager <input checked="" type="checkbox"/> Warranty Dept. <input checked="" type="checkbox"/> Parts Dept. <input checked="" type="checkbox"/> Training Dept. <input checked="" type="checkbox"/> Field Rep.		Date Revised	
Applicable Model Mazda6 (GJ) without power seat system		Applicable Countries or Specifications Europe	

Subject: Driver-side Seat gradually moves down by itself

DESCRIPTION

Some vehicles may experience that the driver-side seat, when it is used in a lifted up position, gradually moves down by itself.

CAUSE

When a load, which is applied to the seat at braking, exceeds a certain level, it could impact the retaining mechanism of seat lifter to cause the seat to move downward.

MASS PRODUCTION CHANGE

Thickness of the carrier plate of seat lifter has been increased.

BEGINNING VIN & DATE OF MODIFICATION

EU spec

JMZ GJ **** **159107 December 3, 2013

REPAIR PROCEDURE

1. Verify the customer complaint. Be sure that the customer is not touching the adjuster by mistake when getting in and out of the vehicle.
2. If the customer complaint has been confirmed replace the driver- seat adjuster unit with a modified one which has been newly established as a service part. Refer to Workshop Manual **“FRONT SEAT BACK COMPONENT REMOVAL/INSTALLATION”** & **“FRONT SEAT CUSHION TRIM REMOVAL/INSTALLATION”**

NOTE:

Below are “Replacement Parts” specified in Workshop Manual, so replace them with new ones.

- Recliner knob (with lever type recliner knob)
- Lifter knob

PARTS INFORMATION

Part Number		Part Name	Q'ty	Remark
New (Service Part)	Original			
GHY1-88-H00	GHW9-88-H00*	Driver-Seat adjuster unit (RH)	1	Note: *:Suffix
GHY1-88-H50	GHK2-88-H50*	Driver-Seat adjuster unit (LH)	1	
	KD45-88-1G5 02	Recliner knob (with lever type recliner knob) (RH)	1	"Replacement Part"
	KF61-88-1H5 02	Recliner knob (with lever type recliner knob) (LH)	1	
	GHW9-88-27X 02	Lifter knob (RH)	1	
	GHK2-88-28X 02	Lifter knob (LH)	1	

WARRANTY INFORMATION

Assembly group	S – Body
Subassembly group	09 - SEAT & SEAT BELTS
Symptom Code	89
Damage Code	97
Causal Part No.	GHY1-88-H00 or GHY1-88-H50
Q'ty	1
Operation No. & Labor Hours	XXK37XRX & 0.7H
Period Covered	Normal warranty period

Note: Enter "Replacement Part" numbers in Related Part Number column.

Ryu Shimizugawa
Manager, Technical Information Gr.
Technical Service Dept.
Mazda Motor Corporation
2D61811719 (MC Internal Use)