



M-TIPS




2004 RX-8

Grease Oozing From Audio Switch

On some vehicles, grease may ooze from the steering wheel mounted audio control switches. The cause of this concern is an excessive amount of grease applied at time of manufacture. This has resulted in a mass production change and the audio control switch has been modified.

- The specified amount of grease applied to the switch during assembly has been decreased.
- The switch button panel finish has been changed to a smooth polished texture.

Customers with this concern should have their vehicles inspected and repaired as necessary. Replace defective switch with a modified one. Refer to Workshop Manual section 09-20-17 AUDIO CONTROL SWITCH REMOVAL/INSTALLATION.

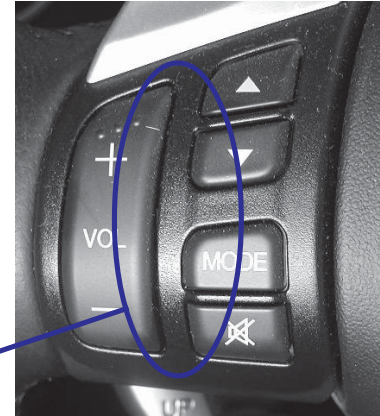

**Grease Will Be Noticeable
In This Area**

<u>Old Part Number</u>	<u>Modified Part Number</u>	<u>Application</u>
F157-66-4M0A	F157-66-4M0B	6MT
F155-66-4D1A	F155-66-4D1B	4AT