



M-TIPS



2004 RX-8

MIL On with DTC P0562

Some vehicles may have a MIL on with a DTC P0562 stored in memory. Customers with this concern should have their vehicle inspected and repaired. Refer to the information below for possible causes of DTC P0562.

- 15 amp “room fuse” missing or blown.
- Room fuse or battery cables installed while ignition key is in ACC or ON position.
- Low battery voltage to PCM (KAM).

Note: After installing the room fuse or restoring battery power, turn the ignition switch to ACC position for 5 seconds before turning ignition switch to ON or Start position. This will set the system voltage for the PCM & Navigation controllers. Vehicles with Navigation may experience operating problems if this procedure is not performed for the first time after installing room fuse or restoring battery power.