

<b>Subject:</b>  POWER WINDOW INOPERATIVE	<b>Bulletin No:</b> 09-035/04
	<b>Last Issued:</b> 9/21/2004

## APPLICABLE MODEL(S)/VINS

2004 RX-8 with VINs lower than JM1FE17\*\*41134228

## DESCRIPTION

Some vehicles may experience an inoperative driver or passenger power window.

Customers having this concern should have their vehicle repaired using the following repair procedure.

## REPAIR PROCEDURE

1. Verify customer concern.
2. Inspect power window motor of inoperative power window. See Workshop Manual section 09 - POWER WINDOW MOTOR INSPECTION.
  - If power window motor is inoperative, go to STEP 4.
  - If power window motor is operative, go to next step.
3. Diagnose power window main switch and/or power window subswitch. See Workshop Manual section 09 - POWER WINDOW MAIN SWITCH INSPECTION and/or POWER WINDOW SUBSWITCH INSPECTION. Repair as necessary.
4. Replace inoperative power window motor with modified part. See Workshop Manual section 09 - POWER WINDOW MOTOR REMOVAL/INSTALLATION.
5. Verify repair.

## PART(S) INFORMATION

Part Number	Description	Qty.	Notes
GJ6A-58-58XC	Power Window Motor (L)	1	
G22C-59-58XC	Power Window Motor (R)	1	

## WARRANTY INFORMATION

**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the SRT microfiche for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	61
Damage Code	97
Part Number Main Cause	SEE PART(S) INFORMATION
Quantity	1
Operation Number / Labor Hours:	XX751XR1 / 0.3 of Hrs (One Side) XX751XR2 / 0.5 of Hrs (Both Sides)