

© 2006 Mazda Motor of America, Inc.

Subject: W / SUNROOF - OVERHEAD CONSOLE LID HARD TO OPEN	Bulletin No: 09-019/06
	Last Issued: 5/8/2006


APPLICABLE MODEL(S)/VINS

2004-2006 RX-8 vehicles equipped with sunroof with VINs lower than JM1 FE**** ** 204221 (produced before March 11, 2006)

DESCRIPTION

Some vehicles equipped with sunroofs may experience the overhead console lid hard to open at times. A burr may be present on the front edge of the overhead console housing, preventing the overhead console lid from opening.


As a mass-production change, this burr has been eliminated. Customers having this concern should have their vehicle repaired using the following repair procedure.

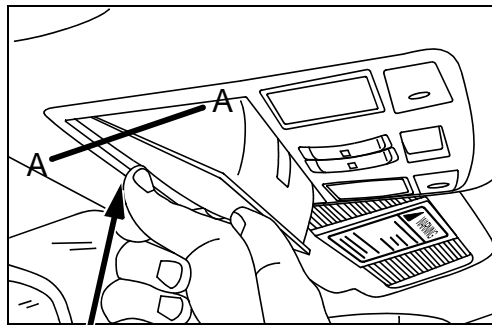

1614b

**BURR CAN BE FELT
USING YOUR FINGER**

A-A CROSS SECTION

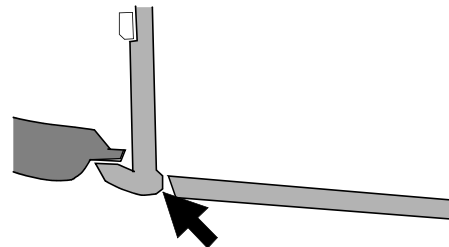


**BURR IS LOCATED
ALONG THIS EDGE**

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.


REPAIR PROCEDURE

1. Verify customer concern.
2. Ensure the housing fits tight into the headliner.
 - Push up and forward on the overhead console housing to ensure it is seated properly.

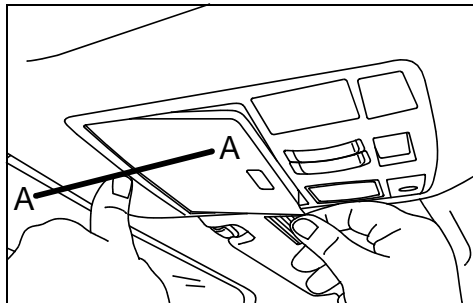

CHECK THAT CONSOLE IS SEATED PROPERLY IN HEADLINER


A-A CROSS SECTION

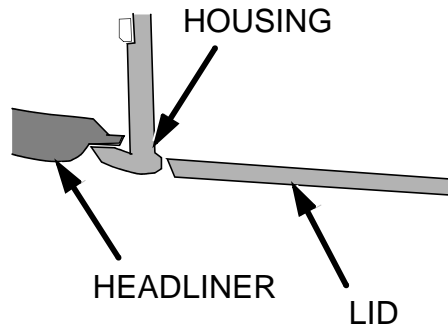

3. Remove the burr from the overhead console housing. Burr can be felt along the edge of overhead console housing using your finger with the lid open.
 - a. Open the lid.
 - b. Insert a steel file such as a fingernail file (thickness: 0.5 mm; width: 10 mm) and close the lid.
 - c. Move the file back and forth along the edge of the lid and the overhead console housing 4 or 5 times to remove the burr.

NOTE:

- DO NOT insert the file more than 15 mm into the console, or damage to the overhead console housing may occur.

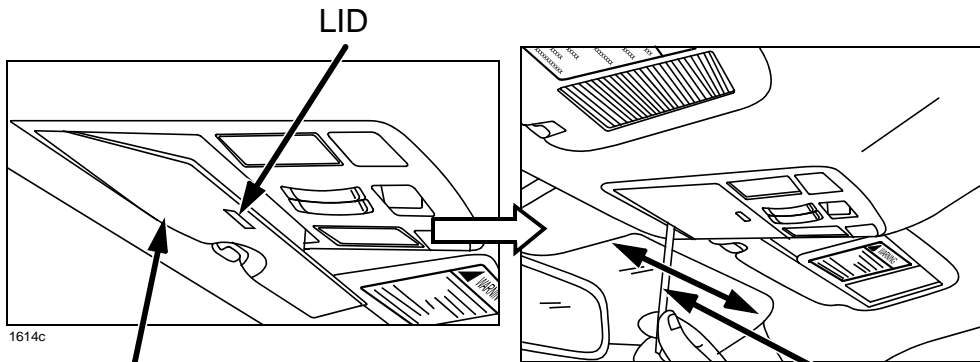

INSERT FILE AT THIS AREA AND CLOSE LID

MOVE FILE BACK AND FORTH ALONG CONSOLE HOUSING EDGE TO REMOVE BURR

4. Verify repair.

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair. Refer to the Warranty Wizard for warranty term information.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	90
Damage Code	9M
Part Number Main Cause	GK2A-69-970B ** (Enter color code)
Quantity	0
Operation Number / Labor Hours:	XXB308RX / 0.2 Hrs