

Subject: SEAT SHAKES BACK AND FORTH / MAKES NOISE WHEN BRAKING	Bulletin No: 09-061/09
	Last Issued: 10/23/2009

APPLICABLE MODEL(S) / VINS

- 2004-2010 RX-8
- 2004-2010 MAZDA3
- 2006-2010 MAZDA5
- 2003-2010 MAZDA6
- 2007-2010 CX-7
- 2007-2010 CX-9

DESCRIPTION


Some vehicles may exhibit a seat that shakes back and forth and is noisy during braking. Customers having these concerns should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

RX-8, Mazda5 & Mazda6 [with pantograph type seat lifter (A)]:


1. Verify customer complaint.
2. Install three (3) springs to the back of the seat cushion seat pan (C) and pipe frame (B).

NOTE: The shape of the spring varies depending on the seat type.

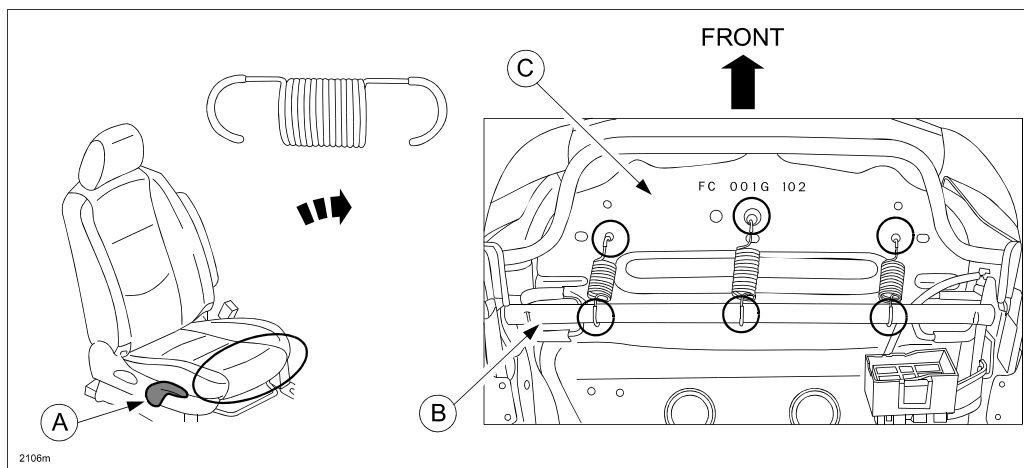

CX-7, CX-9 & Mazda3:

NOTE: The hooks of this type of spring vary depending on which side the hooks fit to.

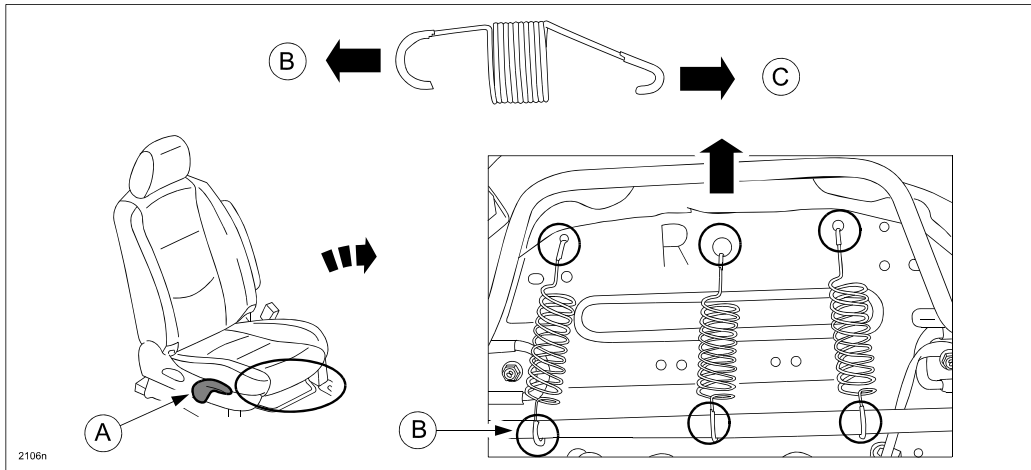

3. Verify repair.

PART(S) INFORMATION

Models	Part Number	Description	Qty.
RX-8, Mazda5 and Mazda6	C2Y1-88-601	Spring	3
CX-7, CX-9 and Mazda3	L2Y1-88-601	Spring	3

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty term.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	82
Damage Code	9H
Part Number Main Cause	7777-NS-ST5
Quantity	0
Operation Number / Labor Hours:	XXE55XRX / 0.2 Hrs. (Spring installation)