Service Information

Mazda Motor Corporation





Category S	Technical		Ref. No. E006/11	Page 1 of 2
Coverage Distributor only Please inform your dealers			Date Issued March 11, 2011	
Please convey this information to your □ Director ■ General Manager ■ Warranty Dept. ■ Parts Dept. ■ Training Dept. ■ Field Rep.			Date Revised	
Applicable Model		Applicable Countries or Specifications		
All models		Worldwide		


Subject: Sunvisor Protector Removal Procedure

DESCRIPTION

In order to avoid breakage of sunvisor stay when removing the sunvisor protector at PDI, make sure to follow the appropriate procedure shown below.

<Incorrect procedure>


If excessive downward force is applied and the sunvisor is detached from the center adaptor, the stay may be broken.

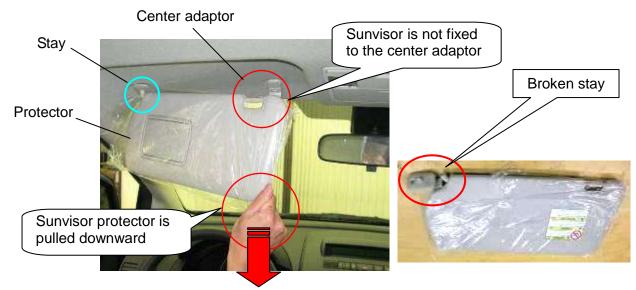


<Appropriate procedure>

Note: This procedure is applicable for both sides. (Following pictures show left side as an example)


1. Make sure that the sunvisor is hooked to the center adaptor.

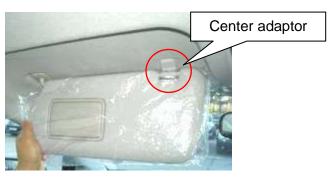


2. In order to avoid any unusual force gets transferred to the stay, pinch the protector and tear it vertically from the cutoff line on the center of protector.

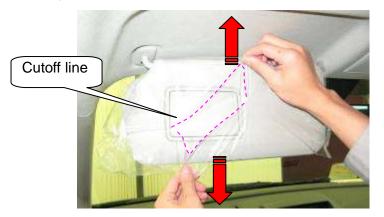

3. Tear the protector and break the welding line on the end so that the protector can be laterally removed on next step.

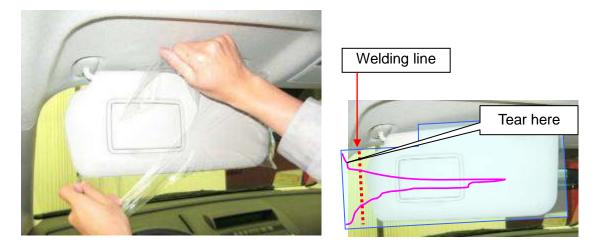

4. Unhook the sunvisor from the center adaptor then laterally remove the protector.

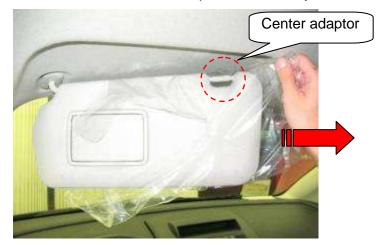

Shinji Kanai Manager, Technical Information Gr. Technical Service Dept. Mazda Motor Corporation 2B10632528 (MC Internal Use)