
Category <b>F</b>	Technical		Ref. No. E030/05	Page 1 of 2
Coverage Distributor only Please inform your dealers			Date Issued November 2, 2005	
Please convey this information to your       □ Director       ■ General Manager         ■ Warranty Dept.       ■ Parts Dept.       ■ Training Dept.       ■ Field Rep.			Date Revised	
Applicable Models		Applicable Countries or Specifications		
RX-8 (FE / SE)		Worldwide		

## Subject: Removal / Installation Cautions for Fuel Distributor Insulator

## DESCRIPTION


When performing a repair on the fuel distributor insulator and/or fuel distributor, foreign substances may stick to the installation surface of fuel distributor insulator. If the bolts are tightened with the foreign substances on the installation surface, cracks may appear on the insulator, resulting in a whistling noise and/or poor acceleration concern.

The following are cautions for removal & installation of the fuel distributor and fuel distributor. Please be sure to follow them.

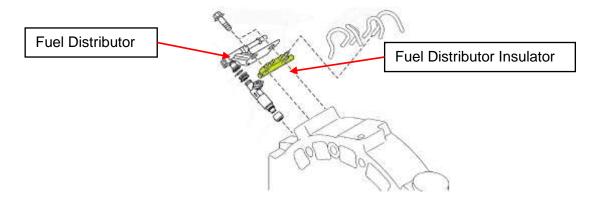


## CAUTIONS FOR SERVICE

1. Prior to installing the fuel distributor insulator in the intermediate housing, be sure to clean the installation surfaces.

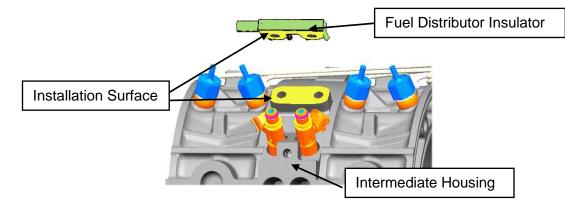

2. Also, prior to installing the fuel distributor on the fuel distributor insulator, be sure to clean the installation surfaces prior to tightening the bolts.

## Tightening Torque: 18.6-25.5N.m

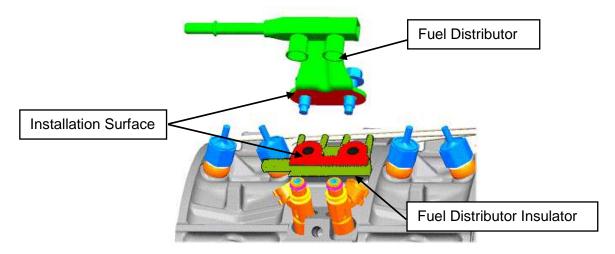

K. Truji

Koji Tsuji Manager, Technical Information Gr. Technical Service Dept. Mazda Motor Corp.