MUTIPLE MODELS W/NAVIGATION
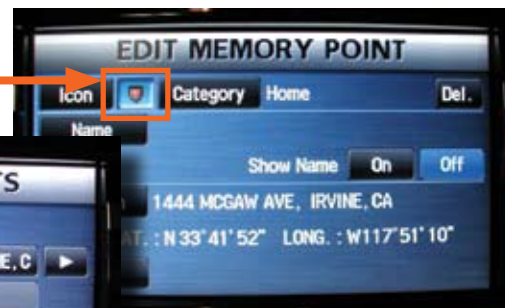### BEEPING NOISE FROM DASH AREA RI6327

Some 2006 and later model year vehicles equipped with navigation may exhibit a mysterious "beep" sound in the dash while driving. This may be due to inadvertent or accidentally programmed sound icons in the navigation system.

Check if sound icons are programmed and remove them as needed using the following procedure.

1. Select MENU.
2. Select ADDRESS BOOK.
3. Select MEMORY POINTS/HOME.
4. Select LIST.
5. Select memory point with an Icon.
6. Display shows EDIT MEMORY POINT.
7. Select ICON. 3 lists of icons are available.
8. Select a non-sound Icon from Page 1 or Page 2, or choose No Icon to remove the sound.

NOTE:
Programmed addresses will display, with an icon beside each one. Non-programmed addresses will show a push-pin.

Sound icons are identified as follows:
- Exclamation
- Bell
- Single note
- Multiple notes
- Siren
- Stop