

© 2012 Mazda Motor of America, Inc.

Subject: AUDIO FUSE (15A) INSTALLATION AT PDI	Bulletin No: 09-033/12
	Last Issued: 08/08/2012


APPLICABLE MODEL(S)/VINS

2013 CX-5 vehicles with VINs beginning with JM3KE*****138048 (produced on or after July 23, 2012)

DESCRIPTION


In order to minimize the reduction of battery capacity by dark current draw during new vehicle transportation, vehicles produced on or after July 23, 2012 are shipped from the plant with the AUDIO1 fuse (15A) removed from the relay and fuse block (A).

When vehicles arrive at your dealer without the AUDIO1 fuse (15A) installed, be sure to install it at PDI according to the following procedure.

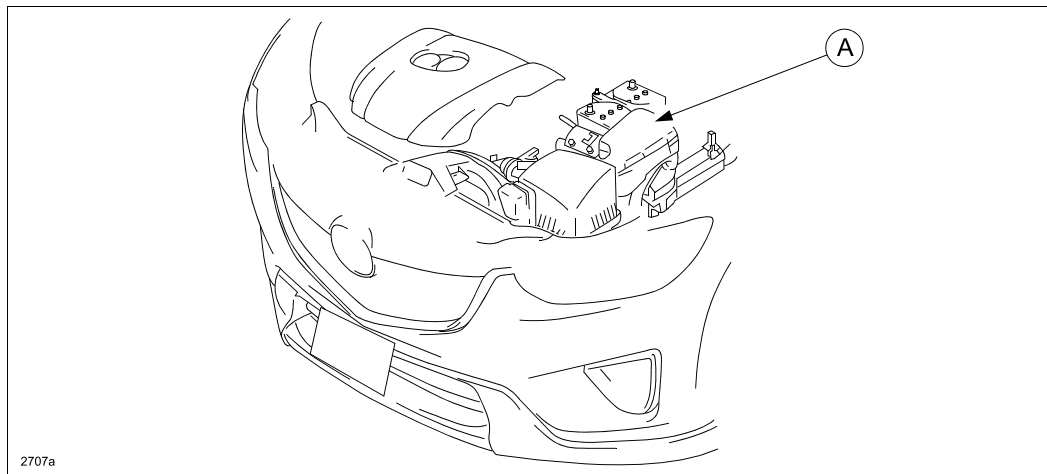


REPAIR PROCEDURE

1. Turn the ignition OFF.
2. Remove the relay and fuse block cover.
NOTE: The AUDIO1 fuse (15A) which was removed at the plant is now in the spare fuse holder in the relay and fuse block cover.
3. Remove the fuse (A) from the relay and fuse block cover.

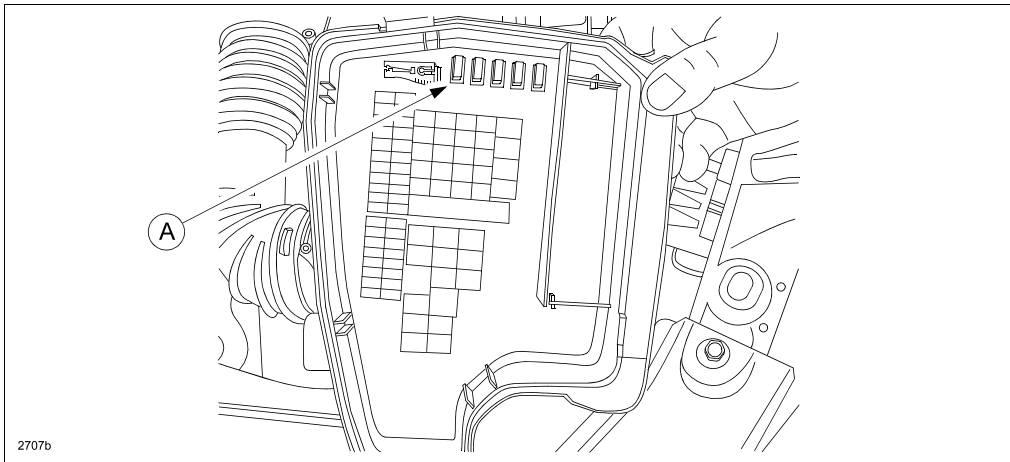

4. Install the fuse in the AUDIO1 fuse cavity (A) in the relay and fuse block.

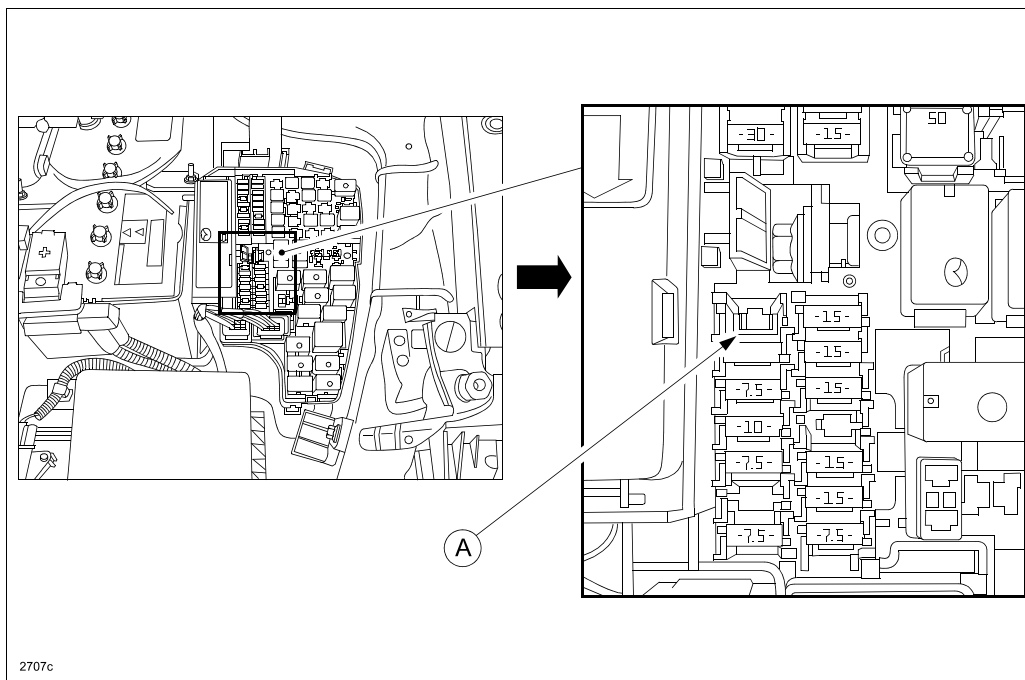

5. Verify the audio system operates properly after fuse installation.