

Service Information

Mazda Motor Corporation

3-1, Shinchi, Fuchu-cho, Aki-gun
Hiroshima 730-8670, Japan
TEL : 81(82)287-5323
FAX : 81(82)287-5220



| | | | |
|---|------------------|---|----------------|
| Category R | Technical | Ref. No. E010/13A | Page 1 of 1 |
| Coverage <input type="checkbox"/> Distributor only <input checked="" type="checkbox"/> Please inform your dealers | | Date Issued May 28, 2013 | |
| Please convey this information to your <input type="checkbox"/> Director <input checked="" type="checkbox"/> General Manager <input checked="" type="checkbox"/> Warranty Dept. <input checked="" type="checkbox"/> Parts Dept. <input checked="" type="checkbox"/> Training Dept. <input checked="" type="checkbox"/> Field Rep. | | Date Revised November 19, 2013 | |
| Applicable Model CX-5(KE), Mazda6(GJ), Mazda3(BM) | | Applicable Countries or Specifications Worldwide | |


REVISED

Revision Note: "Applicable Model" has been revised.

Subject: Stabilizer Bush of Front and Rear

DESCRIPTION

To prevent noise from stabilizer bush, do not apply grease on the bushes of front and rear stabilizer. (Example below shows CX-5 front stabilizer bush)

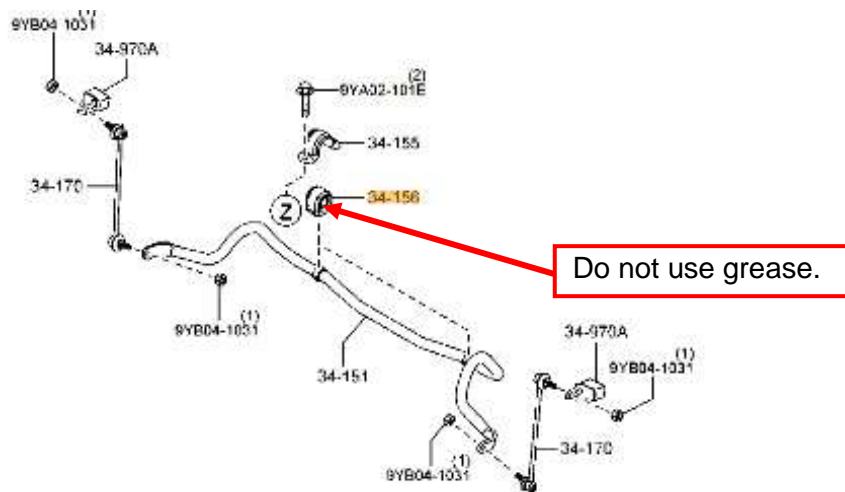

CAUSE

For the newly developed models from CX-5, grip type bushes are installed to prevent noise. If you apply grease mistakenly, a noise due to slipping may occur. Therefore, please do not apply any grease to the bushes of front and rear stabilizer.

Ryu Shimizugawa
Manager, Technical Information Gr.
Technical Service Dept.
Mazda Motor Corporation
2D30505250 (MC Internal Use)