Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



© 2012 Mazda Motor of America, Inc.

Subject: Bulletin No: 09-019/12

Last Issued: 05/09/2012

BULLETIN NOTE

- This bulletin supersedes the previous bulletin 09-017/10 issued on 03/30/10. The APPLICABLE MODEL(S)/ VINS has been revised.
- Changes are noted below in Red beside the change bar.

APPLICABLE MODEL(S)/VINS

2006-2013 MX-5 vehicles with advanced keyless entry system

2006-2011 RX-8 vehicles with advanced keyless entry system

2006-2007 Mazdaspeed6 vehicles with advanced keyless entry system


ESTABLISHMENT OF IGNITION KEY KNOB BASE

2007-2012 CX-7 vehicles with advanced keyless entry system

2007-2013 CX-9 vehicles with advanced keyless entry system

DESCRIPTION

Some vehicles may experience the removeable ignition switch knob no longer snaps onto the ignition switch. If this is the case, be aware that the knob base (A) has been established as a new service part. Use the knob base part instead of replacing the entire key cylinder assembly.

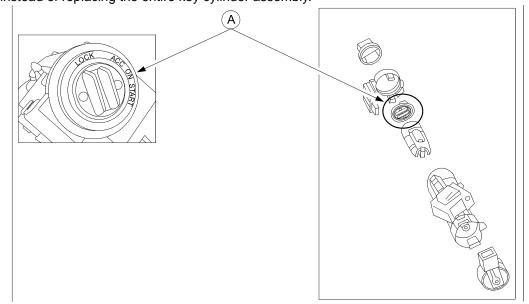

Bulletin No: 09-019/12	Last Issued: 05/09/2012
© 2012 Mazda Motor of America, Inc.	

PART(S) INFORMATION

Part Number	Part Name
D6Y1-76-142	Knob Base